


S361 Technical Data

80 Mesh Rayon Rubber Cloth Tape



Product Composition

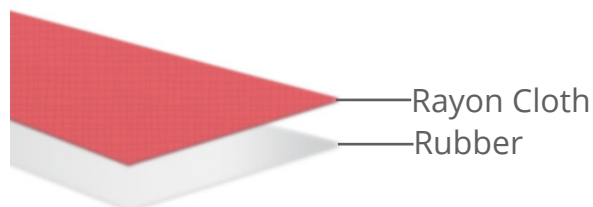

Colours

 S361BL	 S361R	 S361W	 S361Y
 S361G	 S361S	 S361B	 S361BG

Description	Rayon Cloth with Rubber Adhesive
Features/Benefits	Very strong adhesive Hand tearable Waterproof backing
Areas of Use	Lighting/Film Short term masking Book Binding
Applicable Industries	Industrial Film Trade DIY
Standard Sizes Available	24mm x 30m = 36 Rolls/Carton 36mm x 30m = 24 Rolls/Carton 48mm x 30m = 18 Rolls/Carton 72mm x 30m = 12 Rolls/Carton 96mm x 30m = 6 Rolls/Carton 144mm x 30m = 6 Rolls/Carton
Slitting Options	Custom slit available on request
Backing (Liner)	Rayon Cloth
Adhesive Type	Rubber
Maximum Tensile (N/25mm)	189
Elongation at Break (%)	11
Temperature Resistance (°C)	60
Adhesion to Stainless Steel (N/25mm)	11.6
Total Thickness (mm)	0.305 (305 Microns)

The figures above are based off average results from multiple tests, results may vary + or - 5%

Conditions of Use

For best results apply self adhesive tapes between 15°C and 25°C in a dry environment. Application surfaces must be dry and free from dust and particles. Do not apply on surfaces treated or contaminated by anti-adhesives. Avoid contact with surfaces containing plasticizers or other chemical agents not compatible with the tape. Care must be taken with reference to removability without residue and working conditions of the self adhesive tape.

Tape Storage

Ideally store tape between 15°C and 25°C with a maximum relative humidity of 65%. Always store away from heat sources, avoiding exposure to light and if possible keep in the original packaging. When temperatures are lower than 15°C it is highly recommended to recondition the adhesive tape to normal temperatures (15°C to 25°C) before use.

Tape Shelf Life

Self-adhesive tapes technical features are generally not permanent but remain at their best for approximately 12 months, if stored according to suggested conditions and by avoiding extreme environmental conditions such as quick and sudden temperature changes, exposure to UV light and high levels of humidity.

All test methods are based on ASTM standards and Pomona's standardised test methods. The information provided above is based on our experience and tape industry knowledge. It is given in good will but is not intended as a guarantee or a warranty. All end users should ensure for themselves that the product is suitable for their own particular application before using. NB: Peak Force Test: based on ASTM 3759/D ASTM 3759/M and Pomona® test methods, Peel Test: based on ASTM D3330 and Pomona® test methods.